

# 91-20-3 CONVERTIBLE WINDOW SCRATCHED - SEAT LATCH PROTECTORS

## Entire Article

1991 Mercury Capri

### ARTICLE BEGINNING

TECHNICAL SERVICE BULLETIN

### CONVERTIBLE - REAR WINDOW - SCRATCHED BY THE REAR SEAT BACK LATCH

Model LINCOLN-MERCURY: 1991 CAPRI  
Group Body  
Bulletin No. 91-20-3  
Date October 2, 1991  
Symptom Scratched Rear Window

ISSUE: The rear window may be scratched when lowering the convertible top for stowage. This happens when the rear window passes the rear edge of the rear seat back latch.

ACTION: Install three (3) protectors on the rear edge of the latch to prevent window scratches, Figure 1. Refer to the following procedure for service details.

1. Lower the convertible top to raise the stowage lid and gain access to the seat back latch in the stowage area.

NOTE: DO NOT LOWER THE TOP COMPLETELY INTO THE STOWAGE AREA.

2. Clean the latch with a suitable solvent to remove any grease or foreign material and then dry.
3. Install three (3) protectors, complete with glue on the rear edge of the latch as shown in Fig. 2.

NOTE: STORING THE PROTECTORS IN A WARM AREA WILL AID ADHESION OF THE HOT MELT GLUE.

4. Raise the convertible top.

#### PARTS INFORMATION

PART NUMBER	PART NAME	CLASS
FOJY-7313C3-A	Protectors	C

91-20-3 CONVERTIBLE WINDOW SCRATCHED - SEAT LATCH PROTECTORS

Entire Article

1991 Mercury Capri

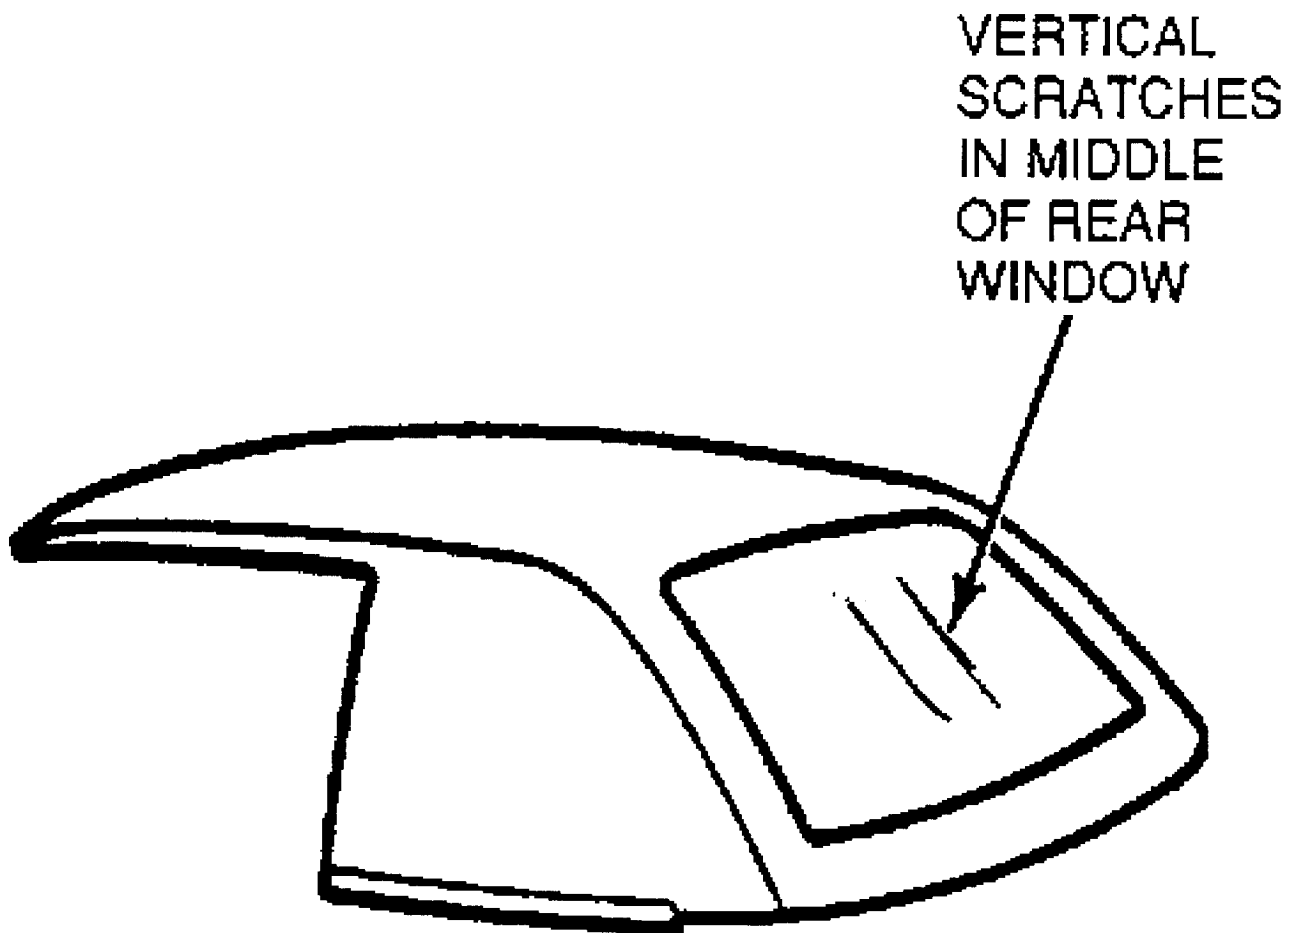


Fig. 1: Rear Window Scratches

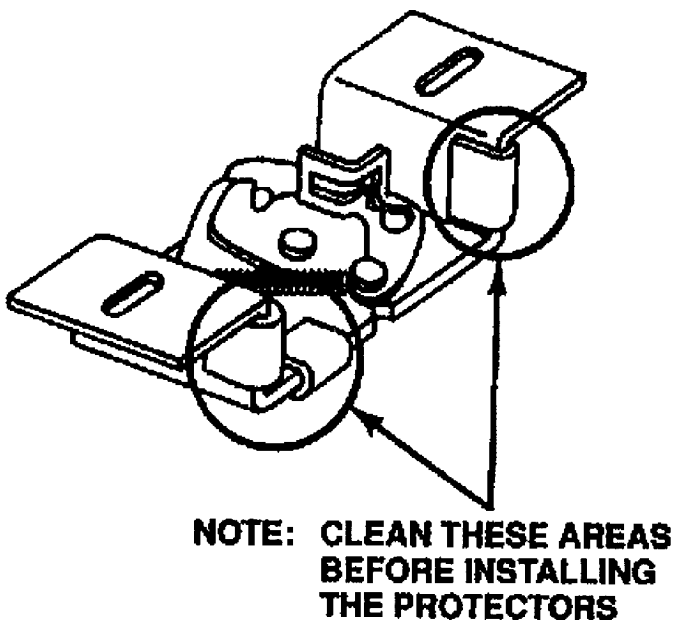


Fig. 2: Installing Protectors

**91-20-3 CONVERTIBLE WINDOW SCRATCHED - SEAT LATCH PROTECTORS**

**Entire Article**

1991 Mercury Capri

**END OF ARTICLE**